

REPORT TO THE CITY OF HELENA

Section 25: Kindrick-Legion Field

November 2, 2015

Legend of Abbreviations

aff... above the finished floor (or
above the finished ground)
AR... Accessible Route
CIL... Change in Level
CFS... Clear Floor Space
lbf... Pounds of Force

Background

RAC staff conducted an access audit at the Kindrick-Legion Field. Our findings are below.

- 1.1 Parking - [CHECKLIST]** lacks designated access aisle [KL1](#); slopes- 2.3% in first stall [KL2](#), [KL3](#); 2.4% in second stall [KL4](#), [KL5](#); 3.4% [KL6](#), [KL7](#); 2.4% in 3rd stall [KL8](#), [KL9](#); 2.9% [KL10](#), [KL11](#); 4.5% in 4th stall [KL12](#), [KL13](#); electrical box in first stall [KL1](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.1.1 through 1.1.3 is integral to compliance with title II program access test):

- 1.1.1 **Repaint** stalls and access aisles to be 8' and 5' each (KL1)
- 1.1.2 **Repair or correct slope** of parking spaces and access aisles to max 2.08% in any direction (KL2, KL3, KL4, KL5, KL6, KL7, KL8, KL9, KL10, KL11, KL12, KL13)
- 1.1.3 **Relocate** first stall to be away from the electrical box (KL1)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

- 1.2 Exterior Accessible Route (includes common area and stairs)- [CHECKLIST-EAR] [CHECKLIST-STAIRS] [CHECKLIST-RAMP]**

Exterior Route: 1" CIL near bottom of ramp [KL16](#), [KL17](#); 13" gap behind stadium seating [KL25](#), [KL26](#); gap at utility cap near 1st base concessions [KL18](#), [KL19](#); cross slopes- 3.5% near brewers office sign [KL14](#), [KL15](#); 2.3% near cracks [KL23](#), [KL24](#); 2.7% in picnic area on 1st base side [KL20](#), [KL21](#); running slopes- 5.7% at concessions [KL27](#), [KL28](#); up to 6.5% at concessions window (checklist)

Stairs: treads lack contract (checklist); lacks detectable warning (checklist); one side lacks handrail [KL415](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.2.1 through 1.2.7 is integral to compliance with title II program access test): (EAR/Stairs)

- 1.2.1 **Repair, bevel, or ramp** CIL along AR (KL16, KL17)
- 1.2.2 **Correct or fill** gaps along AR (KL25, KL26, KL18, KL19)
- 1.2.3 **Correct or repair** cross slope along AR to max 2.08% (KL14, KL15, KL23, KL24, KL20, KL21)
- 1.2.4 **Correct or repair** running slope along AR to max 5% (KL27, KL28, checklist)
- 1.2.5 **Provide contrast** on leading 2" of each stair tread (checklist)
- 1.2.6 **Install** detectable warning strip on top tread of each stairway as a smart practice)

1.2.7 **Install** handrails on both sides of stairway, mounted 34” to 38” aff with top and bottom extensions (KL415)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

Ramps: to main seating center- lip midway in causes trip hazard [KL372](#), [KL373](#); 9% running slope on entry [KL357](#), [KL358](#); 2.6% cross slope at bottom [KL359](#), [KL360](#); gripping surface height fails [KL361](#), [KL362](#), [KL363](#), [KL364](#), [KL365](#), [KL366](#), [KL367](#), [KL368](#), [KL369](#), [KL370](#); bottom handrail extensions fail [KL410](#), [KL411](#); side ramp- 12.3% running slope [KL382](#), [KL383](#); small landing where ramp changes direction [KL384](#), [KL385](#); lacks second handrail [KL398](#); SE side bleachers- 8.4% running slope at top [KL388](#), [KL389](#); 2.4% cross slope [KL386](#), [KL387](#); lacks second handrail (checklist); ramp near entry- running slopes- 8.9% slope on bottom run [KL390](#), [KL391](#); 8.5% slope midway [KL394](#), [KL395](#); 9.2% slope second run [KL396](#), [KL397](#); 3.4% cross slope near bottom [KL403](#), [KL404](#); small landing where ramp changes direction [KL399](#), [KL400](#), [KL401](#), [KL402](#); bottom handrail extensions fail [KL410](#), [KL411](#); NW bleachers- small landing where ramp changes direction [KL405](#), [KL406](#); lacks second handrail (checklist); zip ties on handrail [KL407](#); ramp to concession on 1st base line- gripping surface height fails [KL413](#), [KL414](#); bottom handrail extensions fail [KL412](#); lacks edge protection [KL408](#), [KL409](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.2.1 through 1.2.6 is integral to compliance with title II program access test): (Ramps)

- 1.2.1 **Repair or bevel** CIL along main seating ramp (KL372, KL373)
- 1.2.2 **Correct slope** of main seating, side ramp, SE bleacher ramps and ramp near entry to max 8.33% (KL357, KL358, KL382, KL383, KL388, KL389, KL390, KL391, KL394, KL395, KL396, KL397)
- 1.2.3 **Correct or repair** cross slope of main seating, SE side bleachers, and near entry ramps to max 2.08% (KL359, KL360, KL386, KL387, KL403, KL404)
- 1.2.4 **Replace or install handrails** on both sides of ramps with ones that are rounded and/or extend to the ground, with handrail extensions and mounted 34” to 38” aff (KL361, KL362, KL363, KL364, KL365, KL366, KL367, KL368, KL369, KL370, KL410, KL411, KL398, KL407, KL413, KL414, KL412)
- 1.2.5 **Enlarge landing** on ramps indicated where directions change to 60” by 60” (KL384, KL385, KL399, KL400, KL401, KL402, KL405, KL406)
- 1.2.6 **Install** rail along bottom edge of ramp that prevents a 4” sphere from passing through at ramp to concession on 1st base line (KL408, KL409)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.3 Exterior Entry Signage - [\[CHECKLIST\]](#) no signage at entry (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.31 is integral to compliance with title II program access test):

1.3.1 **Mount signage** at entrance designating it as accessible (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.4 Exterior Entry Doors - [\[CHECKLIST\]](#)

Maneuvering Clearance: field maintenance sheds (2)- storage [KL34](#), [KL38](#), surface fails (checklist); mower shed- storage (checklist); staff entrance Brewers clubhouse- 2.3% and CIL on push [KL46](#), [KL47](#); Brewers locker room- storage back on push [KL63](#), [KL64](#), surface fails on pull [KL66](#); small dugout locker- storage on pull [KL71](#); grandstand- storage on pull [KL74](#), 12.6% slope [KL78](#), [KL79](#); grandstand towards concessions- storage on push [KL89](#); plumbing chase- storage push side [KL111](#); grandstand by legion office- makeshift ramp on pull [KL115](#); reps locker room- 11" to wall on pull [KL124](#), [KL125](#), [KL247](#); visitor clubhouse concessions- storage on push [KL136](#), 10" step [KL132](#), [KL133](#), 10.1% slope [KL130](#), [KL131](#); concessions exit- stairs [KL140](#); visitor clubhouse- shelf on pull [KL146](#), 7" step [KL143](#), 9.5% slope [KL141](#), [KL142](#); well house- no entry [KL155](#), [KL156](#), surface fails [KL155](#), [KL156](#); legion building park side- 15" to wall on pull [KL161](#), [KL162](#), 3% slope [KL159](#), [KL160](#); back exit- gravel back on pull [KL166](#); press box- stairs on both sides, step [KL29](#); Brewers concession- table on pull [KL31](#), concrete deterioration [KL30](#)

Dimension (32"X80"): field maintenance sheds (2)- 72" [KL35](#), each leaf 24" wide; mower shed- 70" [KL41](#), [KL42](#); grandstand towards concession- 28" [KL88](#), [KL89](#); plumbing chase- width fails (checklist); grandstand by legion office- 72" [KL112](#), [KL113](#); storage trailer- 29" [KL128](#), [KL129](#); press box- 30" (checklist)

Change in level: mower shed- 6" [KL39](#), [KL40](#); staff entrance Brewers clubhouse- 2.5" [KL43](#), [KL44](#); dugout storage- 2" [KL69](#), [KL70](#); grandstand- 9" on interior [KL75](#), [KL76](#), [KL77](#); grandstand towards concessions- 7" [KL90](#), [KL91](#); souvenir shop- 3.75" [KL93](#), [KL94](#); women's restroom- 1" [KL106](#), [KL107](#); men's restroom- 1" [KL110](#); grandstand by legion office- 17" below ramp [KL114](#), [KL115](#); storage trailer- 13" [KL126](#), [KL127](#); visitor clubhouse concession- 1" [KL134](#), [KL135](#); concession exit- 1.75" [KL138](#), [KL139](#); visitor

clubhouse- 1" [KL144](#), [KL145](#); legion building park side- 9" [KL157](#), [KL158](#); black exit- 8" [KL167](#), [KL168](#)

Threshold: front office- lip [KL99](#); storage trailer- 1" (checklist); visitor locker room plumbing chase- lip (checklist)

Hardware: field maintenance sheds (2); mower shed (checklist); staff entrance Brewers clubhouse- knob [KL48](#); dugout storage- knob (checklist); small dugout locker- knob (checklist); grandstand- knob (checklist); grandstand towards concession- knob (checklist); 1st base dugout- lack hardware [KL120](#); visitor restroom- [KL123](#); storage trailer- knob (checklist); visitor clubhouse concession- small [KL137](#); concessions exit- small (checklist); legion building park side- knob [KL163](#); back exit- knob (checklist); press box- small (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.4.1 through 1.4.7 is integral to compliance with title II program access test):

NOTE: providing maneuvering clearance is sometimes accomplished by removing temporary barriers such as garbage cans or chairs, or removing and rehanging doors to open in opposite direction, removing closers, providing power door openers, or other similar means. For reference to the technical standards for doorway maneuvering clearance, see Chapter 4, [section 404](#) of the 2010 Standards.

- 1.4.1 For all doors along the public circulation route, **provide** required maneuvering clearance on push and pull side of door (KL34, KL38, KL63, KL64, KL66, KL71, KL74, KL89, KL111, KL115, KL124, KL125, KL247, KL136, KL132, KL133, KL140, KL146, KL143, KL155, KL156, KL161, KL162, KL166, KL29, KL31, KL30)
- 1.4.2 For all doors along the public circulation route, **correct or repair slope** at doorway landing to max 2.08% in any direction for level CFS (KL46, KL47, KL78, KL79, KL130, KL131, KL141, KL142, KL159, KL160)
- 1.4.3 For all doors along the public circulation route, **replace doors** with ones having 80" overhead and 32" clear width (KL35, KL41, KL42, KL88, KL89, KL112, KL113, KL128, KL129, checklist)
- 1.4.4 For all doors along the public circulation route, **repair, bevel, or ramp CIL** at door entries to max .25" (KL39, KL40, KL43, KL44, KL69, KL70, KL75, KL76, KL77, KL90, KL91, KL93, KL94, KL106, KL107, KL110, KL114, KL115, KL126, KL127, KL134, KL135, KL138, KL139, KL144, KL145, KL157, KL158, KL167, KL168, checklist)
- 1.4.5 For all doors along the public circulation route, **replace thresholds** at exterior doors with ADA thresholds (KL99, checklist)
- 1.4.6 For all doors along the public circulation route, **replace hardware** with lever hardware where indicated (KL48, KL120, KL123, KL137, KL163, checklist)
- 1.4.7 **Upon renovation**; make above corrections to employee only doors

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.5 Elevator or Lift – not applicable

1.6 Interior Doors - [[CHECKLIST](#)]

Maneuvering Clearance: furnace- no entry, storage [KL49](#); coach locker room- wall back on pull [KL52](#); coach closet- no entry [KL53](#), [KL184](#); coach office door- desk on pull [KL56](#); storage back on pull [KL57](#), couch back on push [KL58](#); coach office to hall- couch blocks [KL59](#), [KL60](#), [KL61](#); laundry- storage back on pull [KL65](#); trainer office- fridge on pull (checklist); umpire dressing room- 14" to bench on pull [KL72](#), [KL73](#); dugout RR- sink back on pull (checklist); grandstand storage- storage on pull [KL81](#), [KL85](#); souvenir back room- storage back on pull (checklist); office RR- shelf on pull [KL101](#); back office- storage on pull [KL103](#), [KL104](#); beverage storage/senators storage- storage on pull (checklist); brewers storage (former women's)- shelf on pull [KL119](#); manager's office- lockers on pull [KL148](#); furnace- storage on pull [KL154](#); legion RR- sink back on pull (checklist); office- storage on pull [KL164](#), [KL165](#); utility room- water heater on push [KL32](#); storage to concessions- sink on pull [KL33](#)

Dimension (32"X80"): coach bathroom- 29" [KL54](#), [KL55](#); grandstand storage- 76.5" [KL83](#), [KL84](#), 29" [KL82](#); souvenir back room- 29" [KL95](#), [KL96](#); manager's office- 28" [KL147](#), [KL148](#); training room- 28" [KL149](#), [KL150](#); furnace- 28" [KL152](#)

Change in level: souvenir back room- 1" [KL97](#), [KL98](#); beverage storage/senators storage- 1" (checklist)

Threshold: souvenir back room- thick [KL98](#); manager's office- lip (checklist); training room- lip [KL151](#); furnace- lip [KL153](#)

Hardware: umpire dressing room- knob (checklist); dugout restroom- knob (checklist); souvenir back room- knob (checklist); brewer storage (former women's)- knob (checklist); manager's office- knob (checklist); training room- knob (checklist); furnace- knob (checklist); legion restroom- knob (checklist); office- knob (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.6.1 through 1.6.6 is integral to compliance with title II program access test):

NOTE: providing maneuvering clearance is sometimes accomplished by removing temporary barriers such as garbage cans or chairs, or removing and rehanging doors to open in opposite direction, removing closers, providing power door openers, or other similar means. For reference to the technical standards for doorway maneuvering clearance, see Chapter 4, [section 404](#) of the 2010 Standards.

- 1.6.1 For all doors along the public circulation route, **provide** required maneuvering clearance on push and pull side of doors (KL49, KL52, KL53, KL184, KL56, KL57, KL58, KL59, KL60, KL61, KL65, KL72, KL73, KL81, KL85, KL101, KL103, KL104, KL119, KL148, KL154, KL164, KL165, KL32, KL33, checklist)
- 1.6.2 For all doors along the public circulation route, **replace doors** with ones having 80" overhead and 32" clear width (KL54, KL55, KL83, KL84, KL82, KL95, KL96, KL147, KL148, KL149, KL150, KL152)
- 1.6.3 For all doors along the public circulation route, **repair, bevel, or ramp CIL** at door entries to max .25" (KL97, KL98, checklist)
- 1.6.4 For all doors along the public circulation route, **replace thresholds** at exterior doors with ADA thresholds (KL98, KL151, KL153, checklist)
- 1.6.5 For all doors along the public circulation route, **replace hardware** with lever hardware where indicated (checklist)
- 1.6.6 **Upon renovation**; make above corrections to employee only doors

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.7 Interior Accessible Route (includes common area and stairs) -
[\[CHECKLIST-STAIRS\]](#)

Stairs:

Risers: to press box- 8" [KL417](#); in press box- open risers [KL419](#)

Treads: to press box- 8.5" [KL418](#)

Visual Contrast: both lack visual contrast (checklist)

Detectable Warning: both lack detectable warnings (checklist)

Handrails: both lack a second handrail (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.7.1 through 1.7.6 is integral to compliance with title II program access test):

- 1.7.1 **Correct riser heights** on stairs to consistent height between 4" to 7", leave as is if technically infeasible (KL417)
- 1.7.2 **Install** kick plates or replace stairs with closed risers (KL419)
- 1.7.3 **Correct tread depth** on stairs to 11" minimum and consistent, leave as is if technically infeasible (KL418)
- 1.7.4 **Provide** visual contrast on leading 2" of treads (checklist)
- 1.7.5 **Install** detectable warning strip on top tread of each stairway as a smart practice (checklist)

1.7.6 **Install** handrails on both sides of stairway, mounted 34” to 38” aff with top and bottom extensions and having a 1.25” – 2” in diameter, or a non-circular grip that has a perimeter dimension of 4”- 6.25” max (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.8 Public Designated Use Spaces (includes classrooms, meeting rooms, special purpose rooms, and other spaces intended for use by the public) - [CHECKLIST]

Clear floor space: front office- thermostat [KL239](#)

Reach Range: front office- service counter at 44” [KL237](#), [KL238](#), thermostat [KL239](#), key hook [KL240](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.8.1 through 1.8.3 is integral to compliance with title II program access test):

1.8.1 **Remove, or relocate storage** in CFS at fixtures and operable parts (KL239)

1.8.2 **Lower** 36” wide segment of service counter to max 36” aff in front office (KL237, KL238)

1.8.3 **Lower operating mechanisms** in front office to max 48” aff to highest operable part; leave as is if employee only operated (KL239, KL240)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

1.9 Employee Offices and Spaces - [CHECKLIST]

36” access aisle: field maintenance shed (2) [KL182](#); mower shed [KL183](#); coach locker- reduces to 27” at desk [KL185](#), [KL186](#); coach office- reduces to 25” at desk [KL187](#), [KL188](#), and 21” at storage [KL190](#), [KL191](#); laundry [KL193](#); small dugout locker- storage [KL204](#), [KL205](#), [KL206](#); concessions storage (checklist); food storage- shelf reduces entry and storage reduces room [KL86](#), [KL87](#); grandstand hall- reduces at storage, supports, and equipment [KL212](#), [KL217](#); trailer storage [KL244](#); training room- storage [KL254](#), [KL255](#), [KL256](#); furnace [KL257](#); legion office- reduces due to storage [KL265](#), [KL266](#), [KL267](#); concession back room- reduces to 27” to ice [KL176](#), [KL177](#)

80" overhead: food storage- angled ceiling [KL87](#), [KL210](#); grandstand concession- low, angled ceiling [KL219](#); beverage storage/senators storage- low angled ceilings [KL243](#), [KL244](#); Brewers storage/former women's- low angled ceiling [KL246](#)

60" turning space: field maintenance sheds (2) (checklist); mower shed (checklist); small dugout locker (checklist); concessions storage (checklist); food storage- storage [KL87](#); souvenir back room- checklist); back office- closet area too small (checklist); trailer storage (checklist); furnace [KL258](#); press box [KL170](#)

Protruding Objects: grandstand concession- shelf [KL218](#), paper towels 20" [KL223](#), [KL224](#); press box- vents (checklist)

Floor Surfaces: locker room- 4" CIL to ice bath [KL180](#), [KL181](#), [KL202](#), lacks ramp (checklist); grandstand concession- gap at drain [KL228](#); fridge room- 7.8% slope [KL215](#), [KL216](#), [KL211](#); press box- ramp slope fails (checklist)

Clear floor space: laundry [KL194](#), [KL195](#), [KL196](#); locker room- lacks at equipment [KL197](#); grandstand hall- fire extinguisher (checklist); front office- thermostat [KL239](#); back office- air conditioner [KL269](#), lockers (checklist); concession back office- paper towels [KL178](#)

Reach Range: trainer office- hook at 58" aff [KL203](#); small dugout locker (checklist); grandstand concessions- service counter at 36.5" [KL226](#), [KL227](#), paper towels at 60" aff [KL225](#); souvenir shop- white board at 56" aff [KL232](#), [KL233](#); souvenir back room- service counter at 47" aff [KL229](#), [KL230](#), white board at 55" aff [KL232](#), [KL233](#), panel [KL236](#); front office- service counter at 44" aff [KL237](#), [KL238](#), thermostat [KL239](#), key hook [KL240](#); back office- whiteboard [KL242](#); trailer storage- soap over sink [KL252](#); visitor manager office- locker storage high, bulletin board [KL253](#); press box- thermostat at 67.25" [KL171](#), [KL172](#), file boxes high [KL173](#), [KL174](#), [KL175](#); concession back room- hand sanitizer at 55" aff (checklist), paper towels at 63.5" aff (checklist)

Sink: locker room- rim at 36.5" [KL198](#), [KL200](#), [KL201](#); trailer storage- rim at 40" aff with knob hardware [KL250](#), [KL251](#), [KL252](#)

Other: small locker room- noncompliant shower [KL207](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.9.1 through 1.9.3 is integral to compliance with title II program access test):

- 1.9.1 Employee only area permit approach, entry, and exit, **relocate obstacles** to create AR through rooms listed (KL182, KL183, KL185, KL186, KL187, KL188, KL190, KL191, KL193, KL204, KL205, KL206, KL86, KL87, KL212, KL217, KL244, KL254, KL255, KL256, KL257, KL265, KL266, KL267, KL176, KL177, checklist)
- 1.9.2 Employee only areas permit approach, entry, and exit, **relocate obstacles** to create turning space of 60" in rooms listed (KL87, KL258, KL170, checklist)
- 1.9.3 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here

(KL87, KL210, KL219, KL243, KL244, KL246, KL218, KL223, KL224, KL180, KL181, KL202, KL228, KL215, KL216, KL211, KL194, KL195, KL196, KL197, KL239, KL269, KL178, KL203, KL226, KL227, KL225, KL232, KL233, KL229, KL230, KL236, KL237, KL238, KL239, KL240, KL242, KL252, KL253, KL171, KL172, KL173, KL174, KL175, KL198, KL200, KL201, KL250, KL251, KL252, KL207)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

1.10 Assembly Areas - [CHECKLIST] lacks wheelchair accessible and companion seating [KL352](#), [KL353](#), [KL354](#), [KL355](#), [KL356](#); lacks assistive listening devices (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.10.1 through 1.10.3 is integral to compliance with title II program access test):

- 1.10.1 **Provide** nine designated wheelchair seats with adjacent companion seats in assembly (KL352, KL353)
- 1.10.2 **Mount signage** at bleacher seating designating cutout areas as accessible seating (KL354, KL355, KL356)
- 1.10.3 **Advertise the availability** of assisted listening devices, if available, or have resources for acquiring ALDs upon request (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

1.11 Restrooms - [CHECKLIST-MULTIPLE USERS]

Brewers Locker Room: lacks compliant signage (checklist); mirror mounted at 42" [KL281](#), [KL282](#); faucet controls fail [KL282](#); urinal rim at 25.25" aff [KL283](#), [KL285](#); lacks accessible stalls (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 through 1.11.5 is integral to compliance with title II program access test): (Multiple Users-Brewers Locker Room)

- 1.11.1 **Acquire and mount** signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character (checklist)
- 1.11.2 **Lower mirror** so reflective surface is max 40" aff (KL281, KL282)

- 1.11.3 **Replace** faucet controls with lever controls (KL282)
- 1.11.4 **Lower** urinal so that rim height is max 17" aff (KL283, KL285)
- 1.11.5 **Create** a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Visitor Locker Room: lacks directional signage (checklist); lacks accessible stalls and features [KL348](#), [KL349](#), [KL350](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 and 1.11.2 is integral to compliance with title II program access test): (Multiple Users-Visitor Locker Room)

- 1.11.1 **Acquire and mount** signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character (checklist)
- 1.11.2 **Create** a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights (KL348, KL349, KL350)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Main Restrooms:

Both: signage mounting fails, lacks symbol of access [KL304](#); hand dryer and paper towel reach ranges fail [KL305](#), [KL306](#); accessible stall size fails [KL307](#), [KL308](#), [KL309](#), [KL314](#), [KL315](#); lacks ambulatory stall (checklist); paper towels and hand dryers protrude [KL310](#), [KL312](#), [KL313](#)

Women's: grab bar placement fail (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 through 1.11.6 is integral to compliance with title II program access test): (Multiple Users-Main Restroom)

- 1.11.1 **Acquire and mount** signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character at both (KL304)

- 1.11.2 **Lower** paper towel dispenser and hand dryers in both to max 48” to highest operable part (KL305, KL306)
- 1.11.3 **Widen** accessible stalls to min. 60” clear width, 59” depth in both (KL307, KL308, KL309, KL314, KL315)
- 1.11.4 **Create** an ambulatory accessible stall with grab bars and fixtures mounted in correct locations and at correct heights in both (checklist)
- 1.11.5 **Relocate or recess** towel dispenser and hand dryers to not interfere with general circulation path, protrusions can’t be greater than 4” (KL310, KL312, KL313)
- 1.11.6 **Remount** grab bars in women’s to the correct wall and height in accessible stall (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Dugout Restrooms: lacks directional signage (checklist); lacks accessible stalls and features [KL288](#), [KL289](#), [KL290](#), [KL291](#), [KL292](#), [KL316](#), [KL317](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 is integral to compliance with title II program access test): (Multiple Users-Dugout Restrooms)

- 1.11.1 Restroom not accessible, **acquire and mount** signage directing patrons to accessible restroom (KL288, KL289, KL290, KL291, KL292, KL316, KL317)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

[CHECKLIST-SINGLE USER]

Brewers Coach Restroom: lacks directional signage (checklist); lacks accessible features [KL274](#), [KL275](#), [KL276](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 and 1.11.2 is integral to compliance with title II program access test): (Single Users-Brewers Coach Restroom)

- 1.11.1 **Renovate** restroom to be an accessible single user restroom (KL274, KL275, KL276)

1.11.2 **Acquire and mount** signage, including Braille and access symbol mounted on wall, latch side of door, 48” to baseline of lowest character and 60” to baseline of highest character upon renovation (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Office Restroom: dimensions fail (checklist); lacks signage (checklist); lacks clearance (checklist); side grab bar mounting fails [KL294](#); rear grab bar size fails due to sink [KL296](#); grab bars mounted at 37” aff [KL297](#), [KL298](#); lacks vertical grab bar (checklist); mirror mounting fails [KL300](#), [KL301](#); sink controls fail [KL302](#); pipes lack insulation (checklist); paper towel reach range fails [KL303](#); lacks turning space (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 through 1.11.8 is integral to compliance with title II program access test): (Single Users-Office Restroom)

- 1.11.1 **Enlarge** restroom to compliant dimension for CFS and turning space (checklist)
- 1.11.2 **Acquire and mount** signage, including Braille and access symbol mounted on wall, latch side of door, 48” to baseline of lowest character and 60” to baseline of highest character (checklist)
- 1.11.3 **Replace** L shaped bar with one that extends to 54” on the side wall, and 24” to the open side of the toilet on the rear; mounted 33’ to 36” aff (KL294, KL296, KL297, KL298)
- 1.11.4 **Mount vertical grab bar** so bottom is between 39” and 41” from the floor and the centerline between 39” and 41” from rear wall (checklist)
- 1.11.5 **Lower mirror** so reflective surface is max 40” aff (KL300, KL301)
- 1.11.6 **Replace** faucet controls with lever controls (KL302)
- 1.11.7 **Insulate exposed pipes** under sink (checklist)
- 1.11.8 **Lower** paper towel dispenser to max 48” to highest operable part (KL303)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Legion Restroom: lack directional signage (checklist); lacks accessible features [KL318](#), [KL319](#), [KL320](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.11.1 and 1.11.2 is integral to compliance with title II program access test): (Single Users-Legion Restroom)

- 1.11.1 **Renovate** restroom to be an accessible single user restroom (KL318, KL319, KL320)
- 1.11.2 **Acquire and mount** signage, including Braille and access symbol mounted on wall, latch side of door, 48” to baseline of lowest character and 60” to baseline of highest character upon renovation (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

1.12 Concessions – [CHECKLIST-HOME]

Home: service counter at 44.5” aff [KL322](#), [KL323](#); menu lacks pictures [KL329](#); sink rim at 37” aff [KL327](#), [KL328](#); lacks CFS (checklist); sink lacks knee clearance due to cabinet [KL328](#); soda machines protrude [KL324](#); soda machine reach range fails (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.12.1 through 1.12.3 is integral to compliance with title II program access test): (Home)

- 1.12.1 **Lower** 36” wide segment of service counter to max 36” aff (KL322, KL323)
- 1.12.2 **Replace** menu with one having pictures and lettering of compliant size based on viewing distance as a smart practice (KL329)
- 1.12.3 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL327, KL328, KL324, checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

[CHECKLIST-VISITOR]

Visitor: service counter at 46” aff [KL334](#), [KL335](#); menu fails (checklist); lacks access to hand sink [KL336](#), [KL337](#); pipes lack insulation (checklist); route reduces at walk in cooler entry [KL332](#), [KL333](#); 4% slope to drain [KL330](#), [KL331](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.12.1 through 1.12.3 is integral to compliance with title II program access test): (Visitor)

- 1.12.1 **Lower** 36” wide segment of service counter to max 36” aff (KL334, KL335)

- 1.12.2 **Replace** menu with one having pictures and lettering of compliant size based on viewing distance as a smart practice (checklist)
- 1.12.3 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL336, KL337, KL332, KL333, KL330, KL331)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE THREE

Open Air: service counter lacks CFS to due 4.9% slope [KL338](#), [KL339](#) and 3.6% slope [KL340](#), [KL341](#); menu fails (checklist); sink rim at 36" [KL342](#), [KL343](#), [KL344](#); sink pipes lacks insulation (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.12.1 through 1.12.3 is integral to compliance with title II program access test): (Open Air)

- 1.12.1 **Correct or repair** slope in CFS of service counter to max 2.08% to be level (KL338, KL339, KL340, KL341)
- 1.12.2 **Replace** menu with one having pictures and lettering of compliant size based on viewing distance as a smart practice (checklist)
- 1.12.3 For all other deficits, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL342, KL343, KL344, checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.13 Locker Rooms - [\[CHECKLIST\]](#)

NOTE: with regard to locker rooms and playing surfaces (see 1.16 of this report) we understand that the users of the locker rooms and playing surfaces are players and coaches of minor league professional baseball teams, as well as high school (American Legion) teams. Because of that, in our recommendations we treat these as public spaces and not employee spaces. The retrofits below are required by title II.

Brewers: lacks accessible designated lockers with accessible features (checklist); locker hooks high [KL192](#); lacks accessible shower [KL286](#), [KL287](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.13.1 is integral to compliance with title II program access test): (Brewers)

1.13.1 For all deficits for professional players and coaches' locker rooms, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL192, KL286, KL287)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

Visitor: lacks accessible designated lockers with accessible features (checklist); locker hooks high [KL259](#); lacks accessible shower [KL346](#), [KL347](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.13.1 is integral to compliance with title II program access test): (Visitor)

1.13.1 For all deficits for professional players and coaches' locker rooms, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL259, KL346, KL347)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

Umpire: lacks accessible designated lockers with accessible features (checklist); locker hooks high [KL208](#); shelf above bench high [KL209](#); bench size fails [KL209](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.13.1 is integral to compliance with title II program access test): (Umpire)

1.13.1 For all deficits for officials' locker rooms, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL208, KL209)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

Reps: lacks accessible designated lockers with accessible features (checklist); locker hooks high [KL249](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.13.1 is integral to compliance with title II program access test): (Reps)

1.13.1 **Designate 5% or no less than 1 locker** as accessible, mounting signage having the access symbol and hooks and operating mechanisms max 48” aff (KL249, checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

Legion (Senators): lacks accessible designated lockers with accessible features (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.13.1 is integral to compliance with title II program access test): (Legion (Senators))

1.13.1 **Designate 5% or no less than 1 locker** as accessible, mounting signage having the access symbol and hooks and operating mechanisms max 48” aff (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

Coach Shower: transfer shower size fails [KL278](#); shower lacks CFS (checklist); shower controls mounted high [KL277](#), [KL279](#); shower bench fails (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.13.1 is integral to compliance with title II program access test): (Coach Shower)

1.13.1 For all deficits for players and coaches’ locker rooms, **leave as is**, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here (KL278, KL277, KL279)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.14 Aural and Visual Alarms - [\[CHECKLIST\]](#) lacks alarms (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.14.1 is integral to compliance with title II program access test):

1.14.1 Upon renovation **install audible and visual** alarms in all rooms and spaces (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.15 Directional and Permanent Space Signs - [\[CHECKLIST\]](#) signage not in correct location at restrooms (checklist); lacks symbol of access (checklist)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.15.1 through 1.15.3 is integral to compliance with title II program access test):

1.15.1 **Create template for signs** that addresses height of sign, size of characters, location of Braille, and other requirements (checklist)

1.15.2 **Implement a sign revision program** throughout the building, discriminating between directional signs and signs for permanent spaces (checklist)

1.15.3 **Mount signage** at all permanent rooms/spaces having Braille and the international symbol of accessibility, mounted 48" to baseline of lowest character and 60" to the baseline of the highest character sign and on the latch side of the door (checklist)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO

1.16 Other – Park Site [\[CHECKLIST\]](#)

NOTE: with regard to locker rooms (see 1.12 of this report) and baseball playing surfaces we understand that the users of the playing surfaces are players and coaches of minor league professional baseball teams, as well as high school

(American Legion) teams. Because of that, in our recommendations we treat these as public spaces and not employee spaces. The retrofits below are required by title II.

Garbage (13): no issues

VIP Area: lacks AR (checklist); stair access [KL420](#), [KL421](#); lacks accessible table (checklist); lacks AR to upper level serving table [KL422](#); lacks accessible garbage can (checklist)

Legion Side Warm Up: not designed for wheelchair use (checklist); lacks AR [KL423](#)

Legion Side Batting Cage: not designed for wheelchair use (checklist); lacks AR [KL424](#), [KL425](#)

Beer Garden: lacks accessible tables [KL426](#), [KL427](#)

Picnic Area on 1st Base Side: lacks accessible tables [KL21](#)

Warm Up 1st Base Side: not designed for wheelchair use [KL428](#)

Ball Field: not designed for wheelchair use (checklist); stair access to dugouts [KL429](#), [KL430](#), [KL431](#), [KL432](#), [KL433](#), [KL434](#), [KL435](#)

Recommendations (Kindrick-Legion Field is a site designated with accessible features so 1.16.1 through 1.16.7 is integral to compliance with title II program access test):

- 1.16.1 **Provide** a ramp for access to the VIP area (KL420, KL421)
- 1.16.2 **Replace 5%** of the tables in the VIP area with ones of an accessible design (checklist)
- 1.16.3 **Leave as is**, upper level in the VIP area and provide same services on new accessible level (KL422)
- 1.16.4 **Relocate** garbage can in VIP area to be on the accessible level (checklist)
- 1.16.5 **Create AR** with crushed and compacted stone or similar outdoor material from parking or sidewalk to the warm up areas and batting cages (KL423, KL424, KL425, KL428)
- 1.16.6 **Replace 5%** of the tables in the beer garden and picnic area on 1st base side with ones of an accessible design (KL426, KL427, KL428)
- 1.16.7 **Upon renovation** create access to dugout on both sides of the field (KL429, KL430, KL431, KL432, KL433, KL434, KL435)

Responsible Employee	Progress Towards Completion	Recommended Phase
Amy Teegarden Director 406/447-8462	(insert periodic notes regarding steps taken or work completed)	PHASE TWO, PHASE THREE